

LAND CORNER RECORD

Index: R-12	Corner: East Sixteenth corner between Section 21 and 28			State of Indiana - Hoosier National Forest
Section: 21	Township: 7N	Range: 1E	P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1374353.65	Lon./E: 3143909.59	Datum: NAD83(2011) US survey feet	

CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:	Monument Photograph:
9/12/14	Eric L. Deckard L.S. #29900012	Stone	Inst. #2014014303	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
Record evidence of prior survey:	Stone found broken, replaced with a 3 inch aluminum monument set 0.5 feet above grade.			
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
Record evidence of prior survey:				

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Mag nail in Sugar Maple	4"	N30°W	14.20'
	Mag nail in White Oak	23"	S77°E	18.42'
	Mag nail in Pignut Hickory	22"	S57°W	7.43'
Monument Found or Set:	Found 0.7' X 0.25' limestone, 0.4' above grade, broken off 0.3' below grade, replaced with a 3 inch aluminum monument set 0.5 feet above grade. The stone was inverted and buried beside the monument that was set to replace it.			


MONUMENT SKETCH



NARRATIVE REFERENCE:

Monument is a 0.7' X 0.25' limestone, 0.4' above grade, broken off 0.3' below grade, replaced with a 3 inch aluminum monument set 0.5 feet above grade. The stone was inverted and buried beside the monument that was set to replace it. A carsonite post is located approximately 0.5' North of the monument. Located at intersection of North and East running tree and fence remains line. Near West end of East /West ridge top. Approximately 150' to 200' North of East/West ravine, approximately 220' East of NE to SW flowing branch.

SECTION DIAGRAM

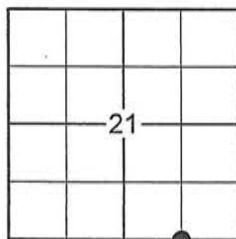

Corner Location = ●

PERPETUATION RECORD:

The origin of the stone is unknown but was locally accepted. The stone is 1.2 feet southwesterly of the midpoint of a line from the Mag spike at R-11 (Quarter Corner common to Section 21 and Section 28) and the pipe at R-13 (Section Corner common to Sections 21, 22, 27, & 28). It was also accepted on the survey by Eric L. Deckard, dated 9/12/2014 (Inst. #2014014303).

Three new bearing trees were established.

Bearing Trees were marked with a blaze, scribed B.T., bearing tree sign, paint, and nail where permission was granted by adjoining landowner.

Section: 21 T7N R1E

Prepared By: BRG (Project#3-565)

Date: 6/2015


Referenced on BRG survey recorded as InstNo.2018004724

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

Index No. R 12 (Alphabetical-Numerical) LAND CORNER RECORD (RECTANGULAR SURVEYS) R9-7 150-4 (Rev. 6/13/67) GPO 802-127
 T. 7N R. 1E 2nd Mer. N.F. Hoosier County Monroe State Ind
E 1/16 Corner common to sections 21 28 and

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed _____	Year of search _____ By _____
Original monument _____ (Wood post, stone, pile of stones, pipe, etc.)	Monument found _____
Bearing Trees	Original Bearing Trees Found
Species _____	Species _____
Diameter _____	Diameter _____
Bearing _____	Bearing _____
Distance _____	Distance _____
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____	Year of search <u>1974</u> By <u>H. Deaton</u>
Where filed or recorded _____	<u>Found Sandstone</u>
Monument _____ (Original, concrete post, iron rod, etc.)	<u>Nailed yellow</u> <u>Post on</u> <u>tree</u> <u>4"</u>
Bearing Trees, Reference Objects	Bearing Trees, Reference Objects
Species _____	<u>Hickory</u> <u>W. Oak</u> <u>Maple</u>
Diameter _____	<u>12"</u> <u>6"</u> <u>3"</u>
Bearing _____	<u>55°W</u> <u>North</u> <u>West</u>
Distance _____	<u>6.7'</u> <u>12.5'</u> <u>17.0'</u>

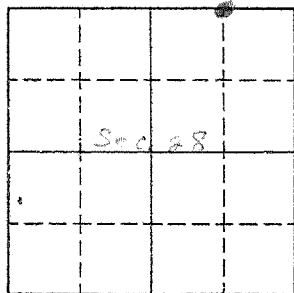

Sketch

○ Corner ☒ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. _____

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

At time of search:

1. Did you have the record description?
 Yes _____ No _____

2. How was search area located?
 Pacing, chaining, photos, maps,
 etc. _____

3. Man hours spent in search _____

4. Do you think additional search might
 recover evidence? Yes _____ No _____

5. Signature _____